

MAURO AUTOMOTIVE INC

1431 STATE RTE 20
 New Lebanon, NY. 12125
 Phone: 518-898-6776 Fax: 000- -

ESTIMATE #

000751

FAC 7128335

Estimate for Services

Estimate Date : 2/6/2024

TOWN OF NEW LEBANON
 14755 Route 22 P.O. Box 328
 New Lebanon, NY 12125
 Cellular: 518-794-8888

2011 Ford - F550 Super Duty - 6.7L, V8 (406CI) VIN(T)
 Lic #: - NY Odom. In: 84576

VIN #: 1FDUF5HTX BEA25937

Part Description / Number	Qty	Sale	Ext	Labor Description	Extended
Separator Assy - Oil DC3Z6A785C	1.00	195.20	195.20	CUSTOMER STATES ENGINE IS KNOCKING	349.73
Nozzle Assy BC3Z9H529F	1.00	460.31	460.31	VERIFIED CONCERN. SELF TESTED P026A CHARGE AIR COOLER EFFICIENCY. FOUND SECONDARY COOLANT LEVEL IS A LITTLE BIT LOW WHICH USES CAUSES THE INTERCOOLER TO LOSE EFFICIENCY. POSSIBLE COOLANT LEAK.	
FULL CAN OF BRAKE PARTS CLEANER BRAKE PARTS CLEANER	3.00	7.39	22.17	P203C REDUCTANT LEVEL SENSOR CIRCUIT LOW VOLTAGE. DID NOT DIAG.	
COOLANT API300LANT	3.00	25.28	75.84	NO OTHER CODES PRESENT. PERFORM RELATIVE COMPRESSION TEST AND THERE WAS NOT MAJOR FAILURES.	
PUMP TO BOOSTER BC3Z-3A717-K	1.00	199.90	199.90	PERFORM POWER BALANCE AND CYL 5 WAS SHOWING AN ISSUE. REMOVED OIL CAP AND THERE WAS PRESSURE.	
HYDRO TO GEAR BC3Z-3A719-P	1.00	122.40	122.40	USED SCANNER TO DISABLE #5 INJECTOR AND THE KNOCK NOISE WENT AWAY BUT THE CRANKCASE PRESSURE WAS STILL THERE.	
TRANSMISSION FLUID TRANS FLUID	3.00	10.49	31.47	AN OPTION WOULD BE TO REPLACE THE BREATHER AND SEE IF THE CRANKCASE PRESSURE GOES AWAY. IF IT DOES THEN THE #5 INJECTOR WOULD NEED TO BE REPLACED TO SEE IF THE KNOCK AND MISFIRE GOES AWAY. APPROVED FOR REPAIRS.	
Brake Caliper (w/ Bracket) - Rear Left 3186XB	1.00	145.44	145.44		
Anti-Seize Lubricant 7651674	1.00	19.15	19.15	OIL SEPARATOR - Remove & Replace - Diesel	279.78
TUBE GREASE 10027	1.00	13.49	13.49	FUEL INJECTOR - Remove & Replace - One,Right Side,w/Dual Rear Wheels	489.62
Disc - Brake 5C3Z2C026CA	2.00	263.85	527.70	REPLACE #5 FUEL INJECTOR AS PER WORKSHOP MANUAL. PERFORMED IAQ ADJUSTMENT AND CHECKED ALL OTHER INJECTORS FOR A MATCH.	
Kit - Caliper Brake Pad 9C3Z2001A	1.00	117.03	117.03	REPLACE BLOWN POWER STEERING LINES	699.45
Seal 5C3Z1S175GA	2.00	81.02	162.04	REPLACE ROTTED LINES FROM PUMP TO BOOSTER AND GEAR TO BOOSTER. REMOVED COOLANT TANK, INTERCOOLER AND CHARGE PIPES TO ACCESS. FILLED POWER STEERING FLUID, PRIMARY AND SECONDARY COOLANT.	
80W140 SYNTHETIC GEAR OIL 80W140	1.00	20.40	20.40	REPAIR REAR BRAKES	769.40
Gasket - Rear Axle Shaft F81Z1001BA	2.00	5.98	11.96	REPLACE REAR ROTORS AND PADS. LEFT REAR CALIPER WAS LEAKING WHEN PRESSED BACK. REPLACED, BLED SYSTEM. REPLACE REAR SEALS AND GREASE. TOP OFF FLUID	
Filter Assy - Oil MU2Z6731C	1.00	46.33	46.33		
1 QT 10W30 DIESEL 10W30 DIESEL	13.00	9.48	123.24	AFTER REPAIRS WERE PERFORMED TEST DROVE, WRENCH LIGHT CAME ON AND DRIVE TO CLEAN EXHAUST MESSAGE APPEARED	139.89
				SELF TESTED P0420 CAT EFFICENCY P0132B TURBO PERFORMANCE P2463 DPF RESTRICTION. EXHAUST IS OVER LOADED. PERFORMED MANUAL REGENERATION.	
				LEFT SIDE BALL JOINTS ARE LOOSE. RIGHT SIDE TIE ROD LOOSE	
				PERFORMED LOF	0.00

MAURO AUTOMOTIVE INC

1431 STATE RTE 20
New Lebanon, NY. 12125
Phone: 518-898-6776 Fax: 000- -

ESTIMATE #

000751

FAC 7128335

Estimate for Services

Estimate Date : 2/6/2024

TOWN OF NEW LEBANON
14755 Route 22 P.O. Box 328
New Lebanon, NY 12125
Cellular: 518-794-8888

2011 Ford - F550 Super Duty - 6.7L, V8 (406CI) VIN(T)
Lic # : - NY Odom. In: 84576

VIN # : 1FDUF5HTX BEA25937

Part Description / Number	Qty	Sale	Ext	Labor Description	Extended

Parts/Supplies: 2,294.07

Labor: 2,727.87

Total : \$ 5,021.94

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle described for testing and/or inspection. Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. SMOG: I understand that I can have emission service and/or adjustments done elsewhere. I hereby waive this right.

TEARDOWN ESTIMATE: I understand that my vehicle will be reassembled within 5 days of the date shown above if I choose not to authorize the service recommended. All Parts removed will be discarded unless instructed otherwise; Save all Parts upon customer request. NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE.

Estimate is valid for 14 days from the time it is generated. Please contact us for updated pricing as parts prices are subject to change.

Signature _____ Date _____ Time _____